




Everything you need for a Basic Conveyor or Bucket Elevator

Included in this kit are all of the components required to install monitoring on a basic flat conveyor or bucket elevator. Sensors are supplied for 4 bearings, 4 belt tracking rub blocks and 1 speed sensor. All hardware, cable protection and mounting brackets are included.

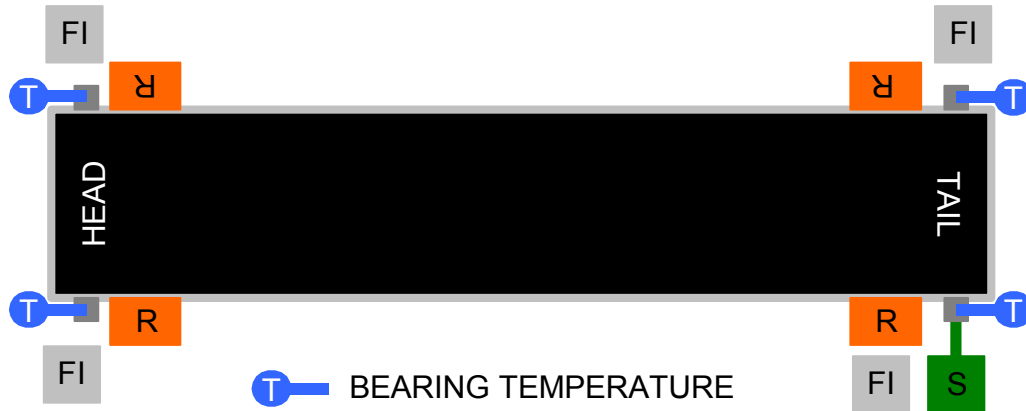

T BEARING TEMPERATURE



R BELT TRACKING RUB BLOCK



S CONVEYOR SPEED



FI FIELD INTERCONNECT





What's included:

Everything you need to setup hazards monitoring on a single simple conveyor or bucket elevator:

Quantity	Part no.	Description
1	mRS001	RPM sensor
1	mRS001-EK	Free hanging installation kit
4	mTS012-4	4" tube bearing temperature sensors
4	mTS012-KIT	Bearing temperature tee fitting
4	mTS015	Brass rub block sensor
4	mBL038D	Brass rub block 4"W x 2"H x 0.5"D
4	mRB-MTGKIT	Rub block mounting kit: 1 - mTRBPMC4HW hinged mounting bracket 2 - 1/4"-20 flathead brass screws 2 - 1/4" brass lock washers 2 - 1/4"-20 brass nuts 4 - 1/4"-20 – 1" Pan head Phillips SS screws 4 - 1/4" x 5/8" SS washers 2 - 1/4"-20 Nylock SS nuts 2 – 1/4" x 20 SS wing nuts
4	mTB006-6	Field Interconnect – 6 port
4	mTB006-MTGKIT	Field Interconnect mounting kit: 1 – mTBBRKT 90° mounting bracket 2 - #10-32 x 3/8" pan head Phillips SS screws 2 - 1/4"-20 x 1.5" Pan head Phillips SS screws 2 – 1/4"-20 Nylock SS nuts
9	mLTT-60	72" cut lengths of plastic liquid tight tubing
18	PS0509N	Liquid tight connector straight, with watertight seal